

How do I Plug a Dug Well?

Fact Sheet



An abandoned water well is:

- 1. A well that has been permanently taken out of use.
- 2. A well that is in such a state of disrepair that using it for any purpose is impractical.
- 3. A well that is either a physical hazard or threatens to contaminate or pollute groundwater aquifers.

All abandoned water wells are required to be plugged in accordance with K.A.R. 28-30-7.

An abandoned water well needs to be permanently plugged by the landowner or a Kansas licensed water well contractor. The plugging of dug water wells should be accomplished by using the following method:

- 1. Measure the water level in the well with a weighted tape measure or string.
- 2. Pour approximately two gallons of chlorine bleach into the well to properly disinfect it.
- 3. Knock down the top five feet of the well wall material and let it fall inside the well.
- 4. Fill the well with sand and gravel to the water level which was measured in Step 1 above. Use the weighted string or tape measure to determine when enough san and gravel have been added.
- 5. Fill in the remaining open space with compacted natural clay or approved grout to a depth of 5 feet below ground surface.
- 6. Use approved cement or sodium bentonite and sodium bentonite grouting material to fill the well from 5 feet to $4\frac{1}{2}$ feet below ground surface.
- 7. After a proper amount of time to allow for the curing of the grouting material, back fill the remaining part of the well with surface soils all the way to the surface.


A record of the plugging of the well is required in accordance with K.A.R. 28-30-7. A plugging record (form WWC-5P) must be submitted to: KDHE-Bureau of Water-Geology Section, 1000 S.W. Jackson Street, Suite 420, Topeka, Kansas 66612-1367, within thirty (30) days following the completion of the above plugging procedures.

If you have any additional questions pertaining to any of the specifics of the procedures, feel free to contact the department at 785.296.3565. Office hours are between 8:00 a.m. to 5:00 p.m., Monday through Friday.

Plugging of a Dug Well

BEFORE

AFTER

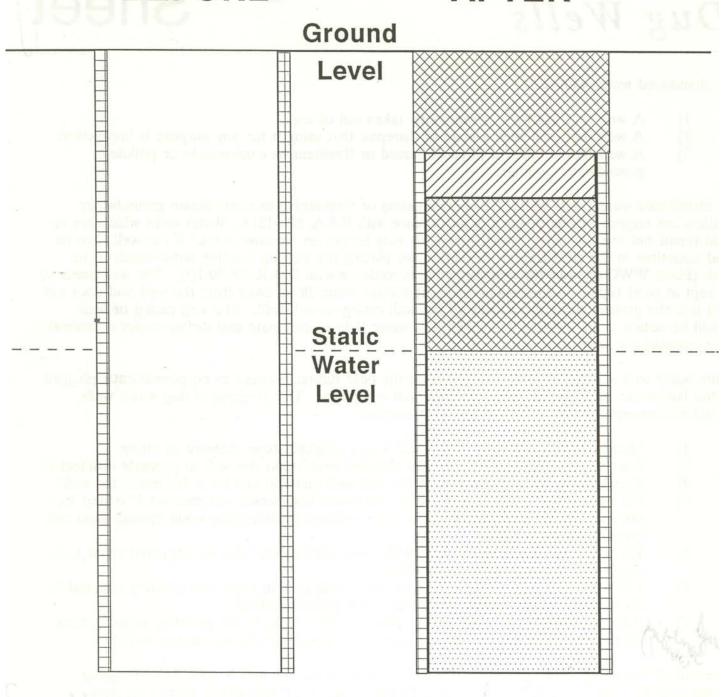

Clay

Grout

Sand & Gravel



Brick or Rock

Cost-Share Assistance

Contact your county office of the Kansas Conservation Commission, Natural Resources Conservation Service, and Local Environmental Protection Programs County Sanitarians (LEPP) about possible financial assistance cost-share funds to assist in abandoned well plugging, and to install replacement wells.

Helpful Contacts & Websites

Kansas Conservation Commission (785) 296-3600 http://www.accesskansas.org/kscc/kcd.html

Kansas Natural Resources Conservation Service (785) 823-4500 http://www.ks.nrcs.usda.gov/AboutNRCS.hmtl

Local Environmental Protection Programs County Sanitarians http://www.kdheks.gov/nps/lepp/lepp.html

KDHE District Offices

Southwest	Northwest
Allen Guernsey, DEA	Dan Wells, DEA
302 McArtor Rd.	2301 E. 13 th
Dodge City, KS 67801	Hays, KS 67601
(620) 225-0596	(785) 625-5663

Satellite Office

313 West Oklahoma
Terrace
Ulysses, KS 67880
(620) 356-1075
Rick Brunetti, DEA
2501 Market Place,
Suite D & E
Salina, KS 67401
(785) 827-9639

South Central

Allison Herring, DEA 130 S. Market, Suite 6050 Wichita, KS 67202 (316) 337-6020

Northeast

North Central

Julie Coleman, DEA 800 W. 24th St. Lawrence, KS 66046 (785) 842-4600

Southeast

David Stutt, DEA 1500 W. 7th St. Chanute, KS 66720 (620) 431-2390

